



Infrastructure Technologies

Gate 5, 2 Normanby Road Clayton VIC 3168, Australia

Telephone: 61 3 9545 2777 Web: <http://www.csiro.au>

Registered Testing Authority - CSIRO

29 August 2017

Our Ref. EN13 / 415 03/0212

TEST REPORT No. 7958.1A

[This report replaces CSIRO report 7958.1]

Requested by: Gerflor Australasia P/L
17 Cato St
Hawthorn East
VIC 3123

on (date): 4 August 2017

Manufacturer: Gerflor

Product Desc.: Accord EL7 with Evercare

Sampling details:

Where: Delivered
Date: 4 August 2017
By whom: Courier
How (methods): N/A

The results reported relate only to the sample(s) tested and the information received. No responsibility is taken for the accuracy of the sampling unless it is done under our own supervision. CSIRO cannot accept responsibility for deviations in the manufactured quality and performance of the product. While CSIRO takes care in preparing the reports it provides to clients, it does not warrant that the information in this particular report will be free of errors or omissions or that it will be suitable for the client's purposes. CSIRO will not be responsible for the results of any actions taken by the client or any other person on the basis of the information contained in the report or any opinions expressed in it. The reproduction of this test report is only authorised in the form of a complete photographic facsimile. Our written approval is necessary for any partial reproduction.

This test report consists of 4 pages

SUMMARY OF SLIP RESISTANCE TESTS PERFORMED:

		Result	Class
AS 4586:2013	Slip resistance classification of new pedestrian surface materials Appendix A: WET PENDULUM TEST METHOD (Slider 96): Mean SRV:	32	P2

In order to interpret the classifications, please refer to Standards Australia Handbook 198, An Introductory Guide to the Slip Resistance of Pedestrian Surface Materials, which recommends minimum classifications for a wide variety of locations.



It is important to realise that test results obtained on unused factory-fresh samples may not be directly applicable in service, where proprietary surface coatings, contamination, wear and subsequent cleaning all influence the behaviour of the pedestrian surface.



REPORT NO: 7958.1A
ISSUE DATE: 29 August 2017
MANUFACTURER: Gerflor
PRODUCT DESC: Accord EL7 with Evercare

Page 2 of 4

PHOTOS:

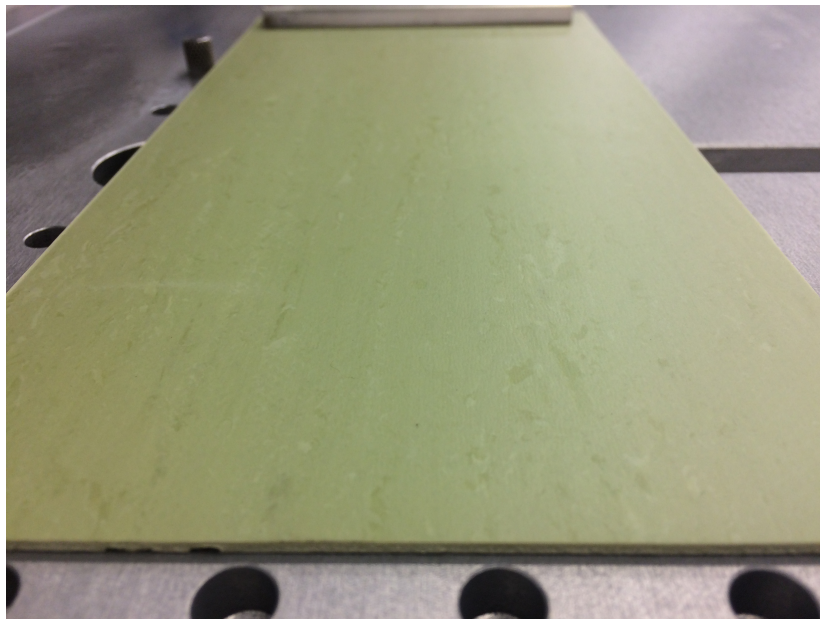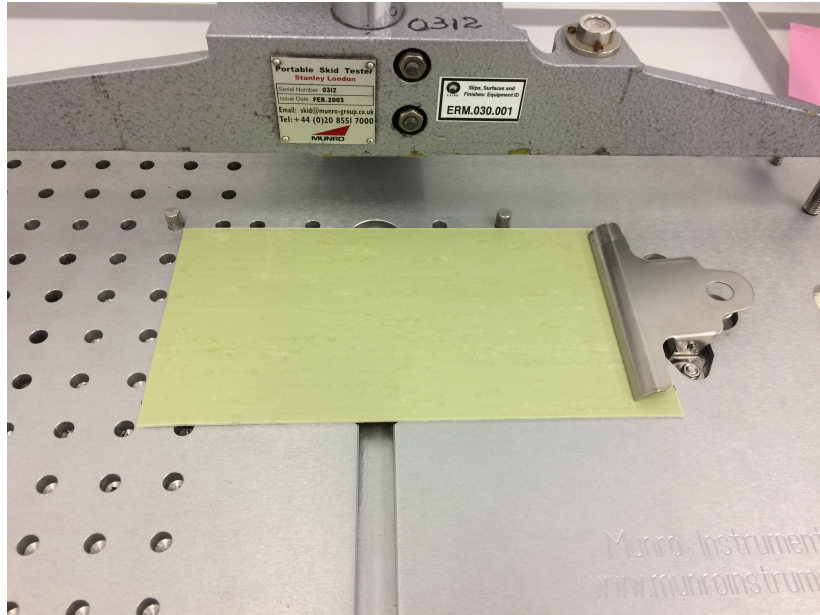



REPORT NO: 7958.1A
ISSUE DATE: 29 August 2017
MANUFACTURER: Gerflor
PRODUCT DESC: Accord EL7 with Evercare

SLIP RESISTANCE CLASSIFICATION OF NEW PEDESTRIAN SURFACE MATERIALS

WET PENDULUM TEST METHOD

TEST CARRIED OUT IN ACCORDANCE WITH
AS 4586:2013 (Appendix A)

Test Date: 28 August 2017

RESULTS:	Location:	Slip Resistance Laboratory	Slider used: 96
	Sample:	Unfixed	Conditioned with grade P400 paper, dry
	Cleaning:	Deionized water	and Imperial Lapping Film Grade 3MIC, wet
	Temperature:	21.6°C	

Pendulum Friction Tester: ERM.030.001 (S/N: 0312, calibrated 16/06/2016)
Test conducted by: Khanh Ho

	Specimen				
	1	2	3	4	5
Last 3 swings (BPN)	32	31	32	30	34
	32	31	32	29	34
	31	31	32	29	34
Averages	32	31	32	29	34

Mean SRV : 32

CLASS :

P2



Infrastructure Technologies

Gate 5, 2 Normanby Road Clayton VIC 3168, Australia
Telephone: 61 3 9545 2777 Web: <http://www.csiro.au>

REPORT NO: 7958.1A
ISSUE DATE: 29 August 2017
MANUFACTURER: Gerflor
PRODUCT DESC: Accord EL7 with Evercare

Page 4 of 4

Date and Place 29 August 2017, Clayton, Vic

Name, Title and Digital Signature:

A digital signature in black ink, appearing as a stylized cursive 'KH' followed by a horizontal line, overlaid on a faint, circular CSIRO logo watermark.

KHANH HO
Technical Officer
Tel: 61 3 95452777
Email: Khanh.Ho@csiro.au