



OIL-WET INCLINING PLATFORM SLIP RESISTANCE TEST

Saga2 Connect vinyl tile

Prepared for: Gerflor Australasia Pty Ltd
Steven Gradecak
17 Cato Street
HAWTHORN EAST VIC 3123

Specimen Description: Saga2 Connect vinyl tile, 500x713 mm.

No. of Specimens: 2 off

Surface Structure: Smooth

Specimen Preparation: Washed with water and pH neutral detergent, rinsed then dried.

Specimen Configuration: Unfixed

Test Direction: Test direction not applicable.

Joint Type & Width: N/A

Air Temperature: 21°C

Test Standard: AS 4586:2013 Slip resistance classification of new pedestrian surface materials, Appendix D - Oil Wet Inclining Platform Test

Test Shoe: Leipzig V73-SP

Test Location: ATTAR, Unit 1, 64 Bridge Road, Keysborough.

Test Date: 29 July 2019

Test Personnel: Dale Siegle and Marcus Braché

Displacement Space (rounded to the nearest 0.5cm ³ /dm ²):	Not tested
Displacement Space Assessment Group (Appendix E, AS 4586 - 2013):	Not tested
Corrected mean overall acceptance angle (α_{ave}) (rounded down to the nearest degree):	15°
Classification:	R10

These results apply only to the specimens tested and it is recommended that before selection of flooring or paving materials the effect of service conditions, including maintenance procedures and wear on their slip resistance be checked.

Reviewed By:



Dale Siegle
Compliance and Test Technician
Approved Signatory



Marcus Braché
Senior Engineering Technician
Approved Signatory

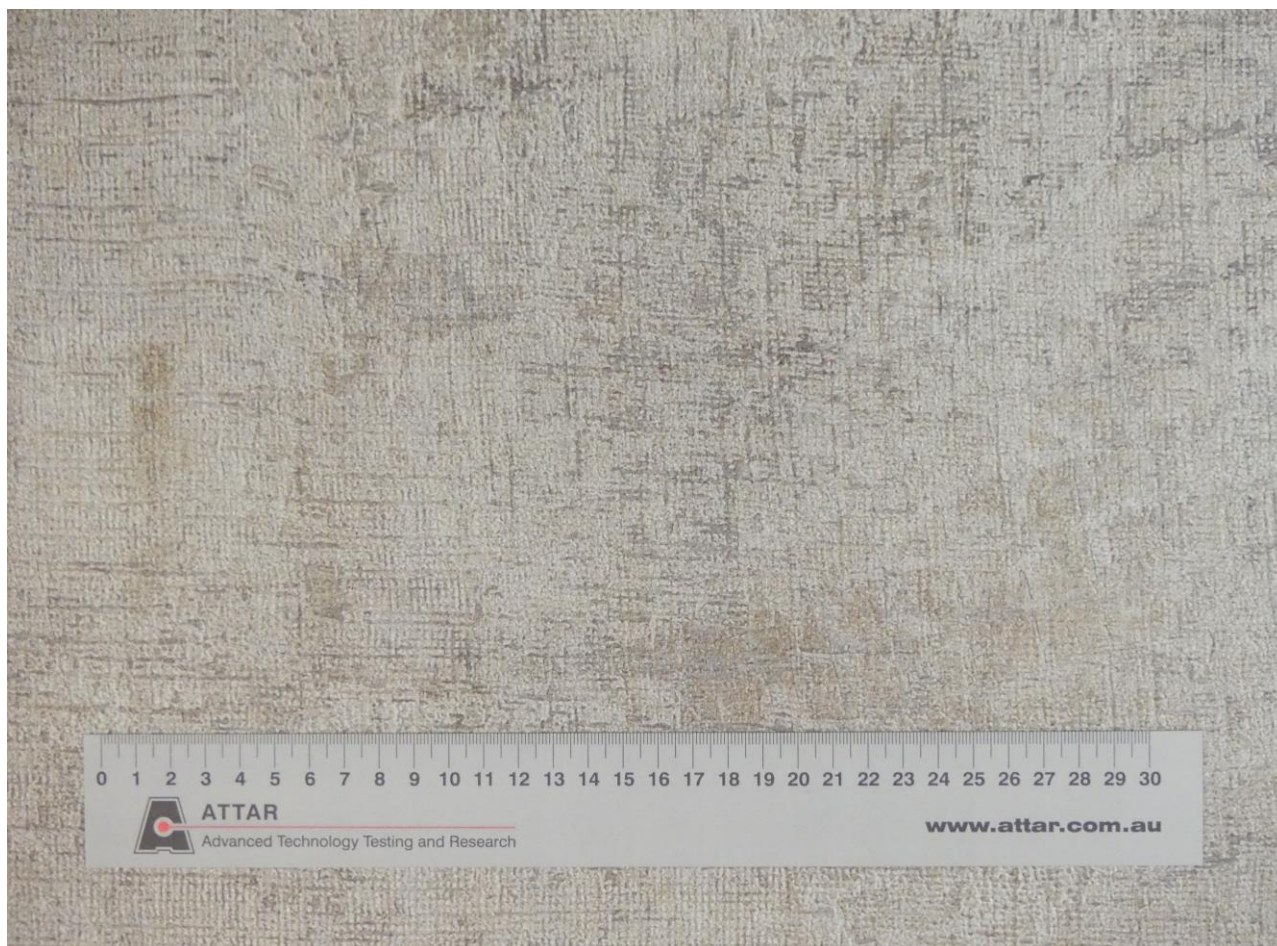


Figure 1: Saga2 Connect vinyl tile

CLASSIFICATION CRITERIA – AS 4586 - 2013
Oil Wet Inclining Platform Test – Appendix D

Compliance

**TABLE 5: CLASSIFICATION OF PEDESTRIAN SURFACE MATERIALS ACCORDING TO THE
OIL-WET INCLINING PLATFORM TEST**

Classification	Angle, degrees
No Classification	<6
R9	≥6 <10
R10	≥10 <19
R11	≥19 <27
R12	≥27 <35
R13	≥35